


LASER SAFETY AT UNLV

UNLV Risk Management and
Safety Department
Radiation Safety Office



Outline

- **Laser fundamentals**
 - Laser theory and operation
 - Components
 - Types of lasers
- **Laser hazards**
 - How they are classified
- **Laser control measures**
 - Warning signs and labels
 - Protective equipment
- **Laser safety at UNLV**

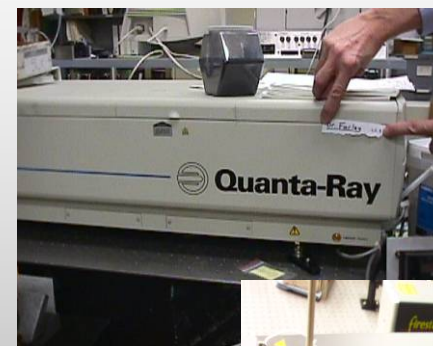


LASER

- Light Amplification by Stimulated Emission of Radiation






Basic Laser Principles

- **Laser light is a form of electromagnetic radiation that carries energy and momentum which may be imparted when it interacts with matter**

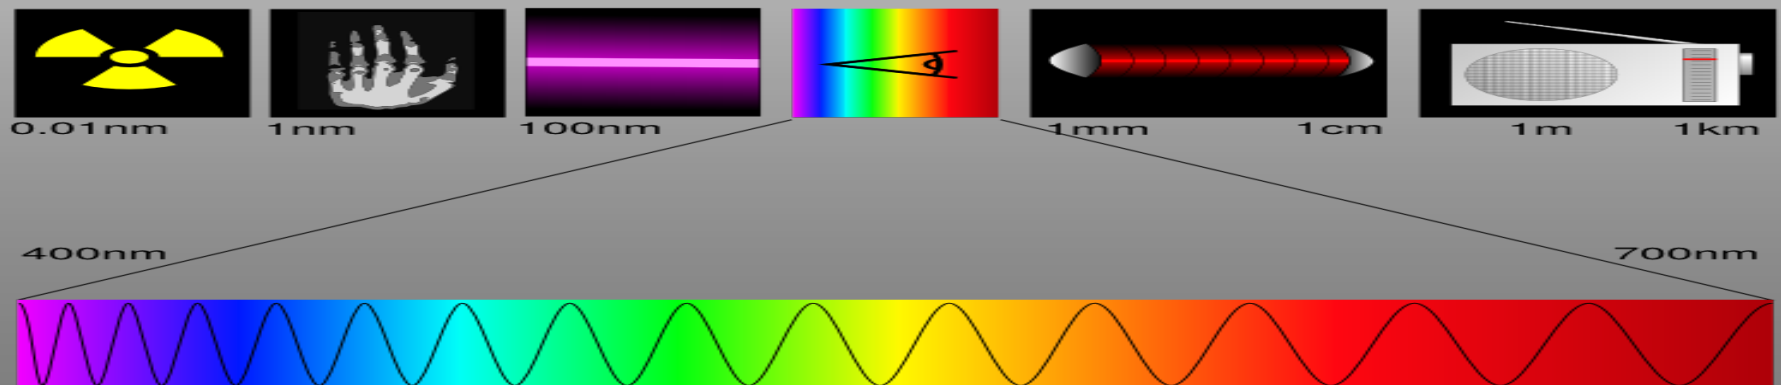

Basic Laser Principles: Light Output

- **Laser Light Source**
 - Intense
 - Monochromatic
 - Directional
 - Coherent

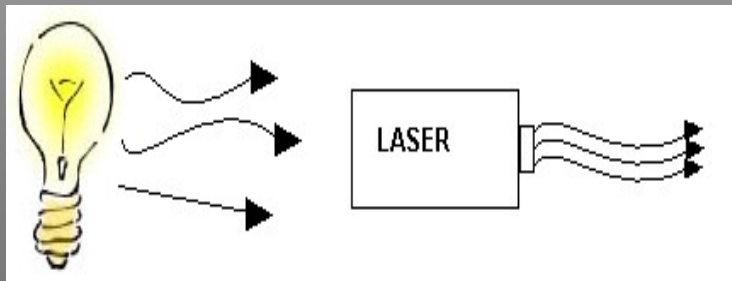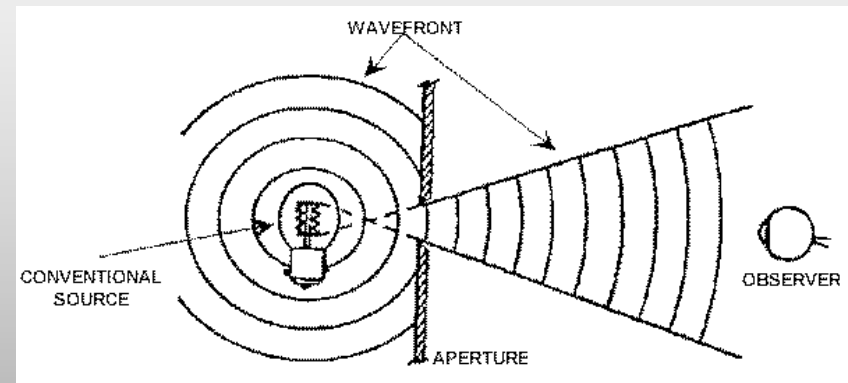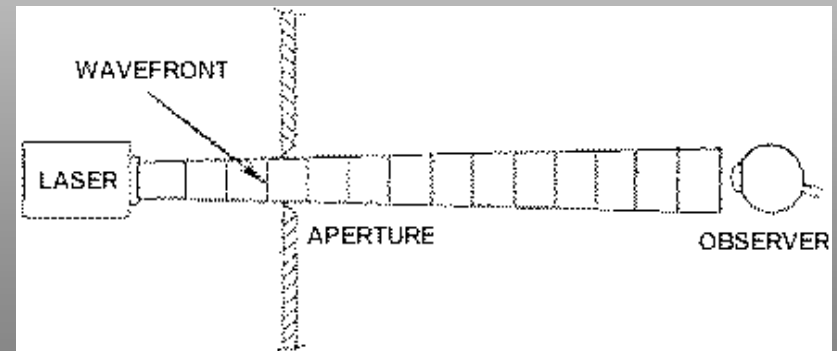

Types of Laser Media

The differences depend on the type of active medium used

- Gas**
- Solid**
- Semiconductor/Diode**
- Dye**
- Excimer**


Types of Lasers

Lasers can be described by:

- **which part of the electromagnetic spectrum is represented:**
 - Infrared
 - Visible Spectrum
 - Ultraviolet
- **the length of time the beam is active:**
 - Continuous Wave
 - Pulsed
 - Ultra-short Pulsed

Common Ultraviolet Lasers

Ultraviolet (UV) radiation ranges from 200-400 nm

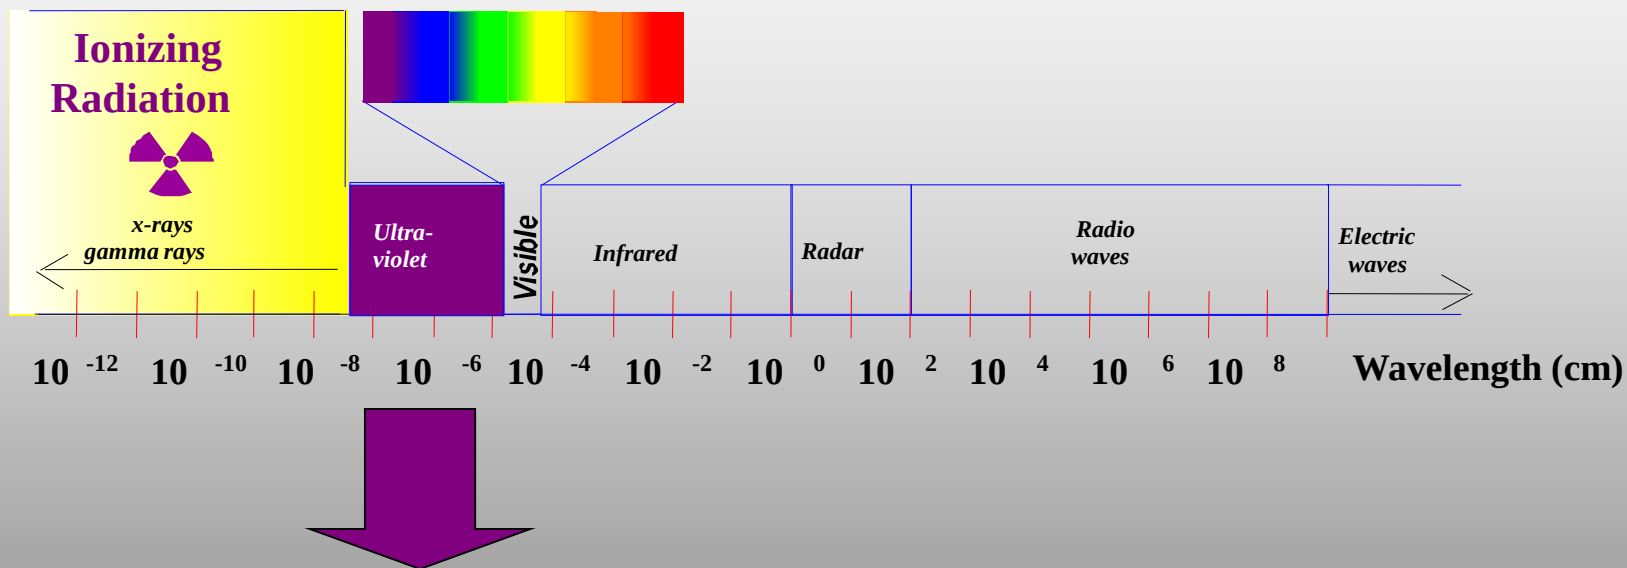

Common Ultraviolet Lasers

Argon fluoride	Krypton chloride	Krypton fluoride	Xenon chloride	Helium cadmium	Nitrogen	Xenon fluoride
193 nm	222 nm	248 nm	308 nm	325 nm	337 nm	351 nm


Common Visible Light Lasers

Violet	Helium cadmium	441 nm
Blue	Krypton	476 nm
	Argon	488 nm
Green	Copper vapor	510 nm
	Argon	514 nm
	Krypton	528 nm
	Frequency doubled Nd YAG	532 nm
	Helium neon	543 nm
Yellow	Krypton	568 nm
	Copper vapor	570 nm
	Rhodamin 6G dye (tunable)	570 nm
	Helium neon	594 nm
Orange	Helium neon	610 nm
Red	Gold vapor	627 nm
	Helium neon	633 nm
	Krypton	647 nm
	Rhodamin 6G dye	650 nm
	Ruby (CrAlO ₃)	694 nm

The wavelength range for light that is *visible* to the eye ranges from 400-760 nm

Common Infrared Lasers

Infrared radiation ranges from 760-1,000 nm

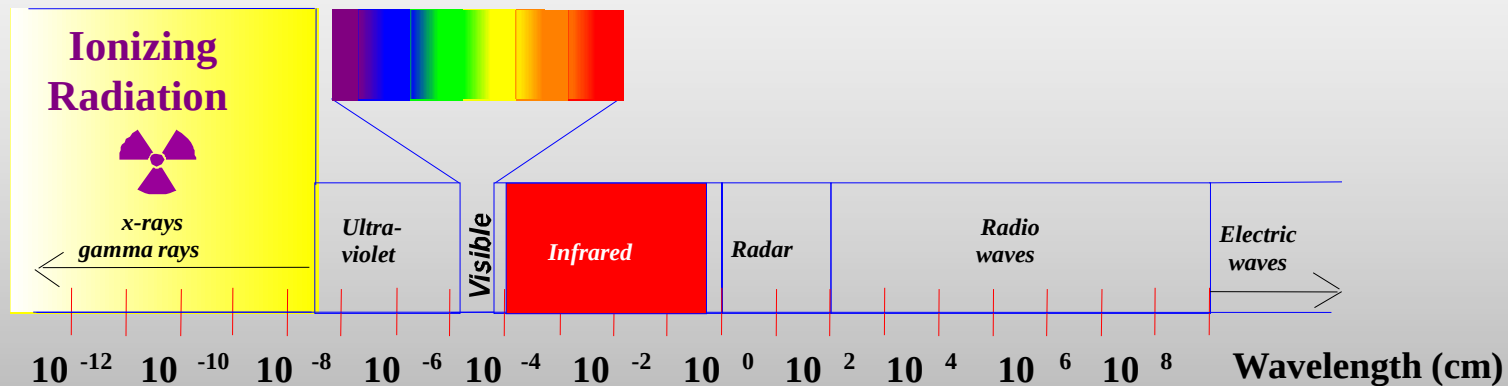

Common Infrared Lasers

Near Infrared							Far Infrared	
Ti Sapphire	Helium neon	Nd:YAG	Helium neon	Erbium	Hydrogen fluoride	Helium neon	Carbon dioxide	Carbon dioxide
800 nm	840 nm	1,064 nm	1,150 nm	1,504 nm	2,700 nm	3,390 nm	9,600 nm	10,600 nm

Active Beam Time

- Lasers may be characterized in part by their *temporal output*:
- Continuous Wave (CW)– laser output is steady (output in units of power, watts)
- Pulsed (output in units of energy, Joules)
- Q-switched - laser pulse duration is extremely short (nanoseconds and shorter). These lasers can output pulses of very high energy due to the very short time duration

Dangers associated with the use of lasers

- **Beam/Reflection** hazards
 - eye damage
 - skin damage
- **Non-beam** hazards
 - electrical hazards
 - toxic/carcinogenic laser dyes
 - hazardous gases (e.g. excimer lasers)
 - fire


Types of Beam Exposures

- Intra-beam exposure the eye or skin is exposed directly to all or part of the laser beam. The eye or skin is exposed to the full irradiance or radiant exposure possible
- Specular reflection is a reflection from a mirror-like surface. A laser beam will retain all of its original power when reflected in this manner
Note that surfaces which appear dull to the eye may be specular reflectors of IR wavelengths
- Diffuse reflection is a reflection from a dull surface.
Note that surfaces that appear shiny to the eye may be diffuse reflectors of UV wavelengths

Biological Damage


- **Biological damage caused by lasers is produced through**
- **thermal,**
- **acoustical, and**
- **photochemical processes**

Biology of the Eye

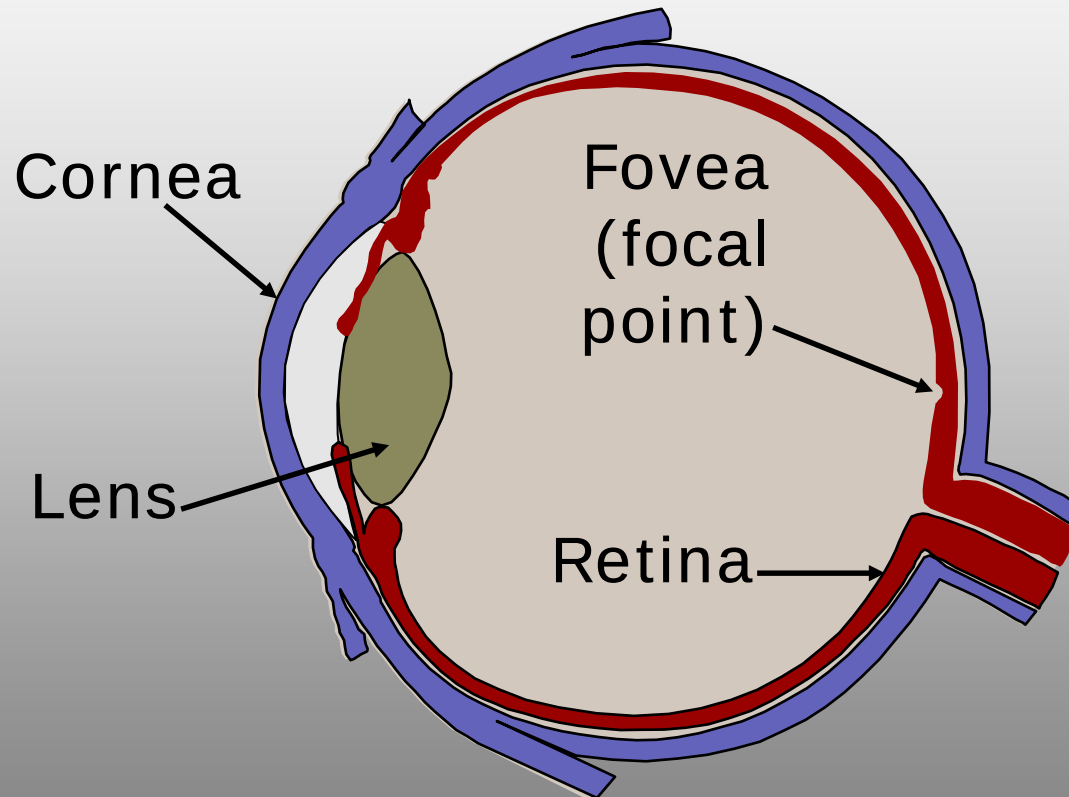

Retinal Hazard Region

The wavelength range of light that can enter the eye is 400 to 1400 nm, though the range that we can actually see is only 400 – 700 nm

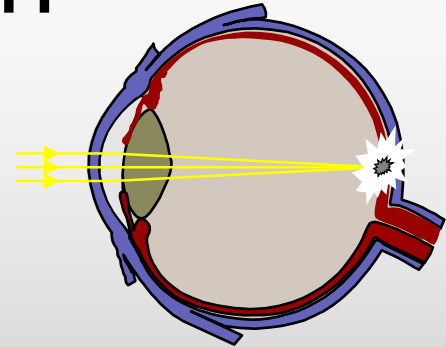


The eye can focus a collimated beam of light to a spot 20 microns in diameter on the retina (called the *focal point*)

This focusing ability places the retina at risk when exposed to laser light in the wavelength range that will penetrate to the retina, because even fairly low wattage laser light can impact the retina with 100,000 times the radiant power that entered the eye. Because of this optical gain, laser light in the 400 – 1400 nm is referred to as the *Retinal Hazard Region*


This is important to remember when working with infrared lasers, because the retina can be injured even though the laser beam is invisible

Sensitivity to damage: eye transmission


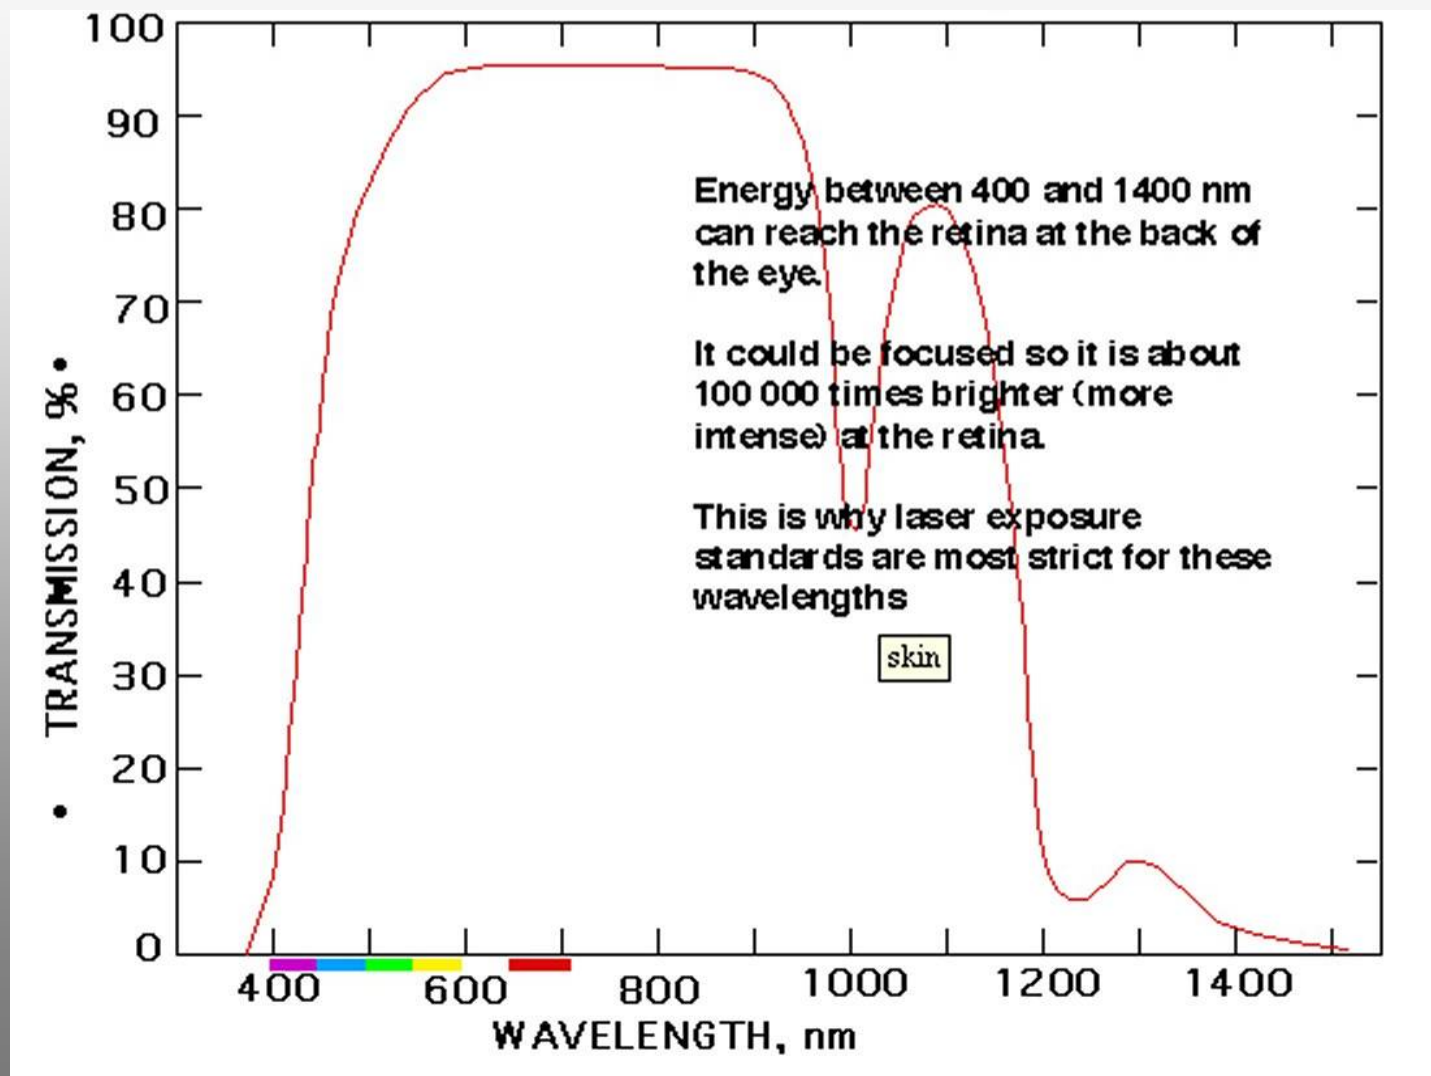


Effect of laser beam depends strongly on wavelength


• Radiofrequency and Gamma Rays

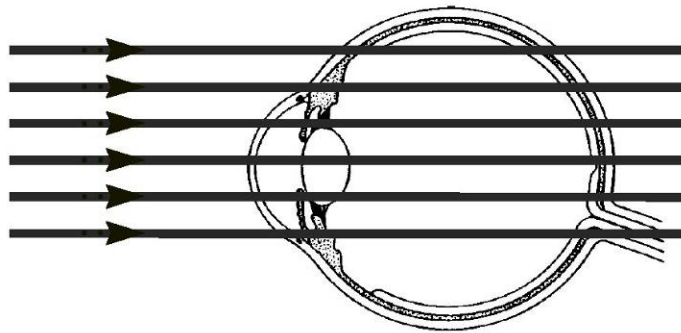

• Near Ultraviolet

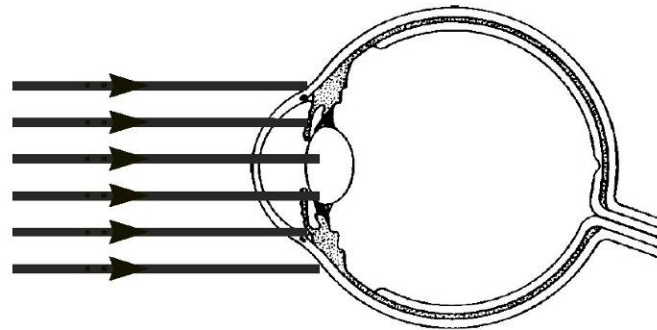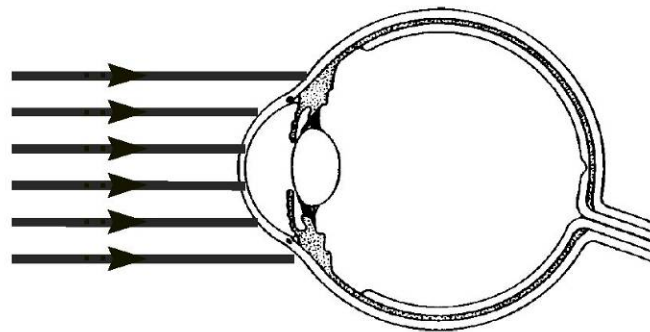

• Far Ultraviolet and Far Infrared

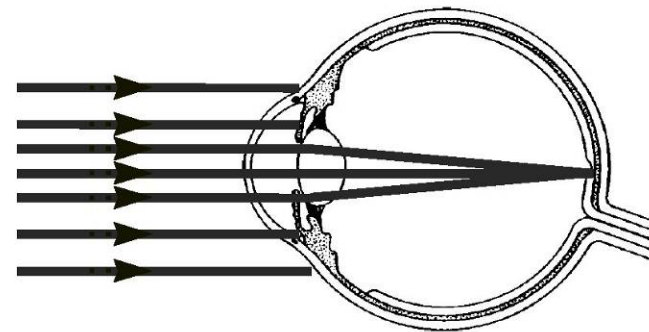

• Visible and Near Infrared

Example of eye injury


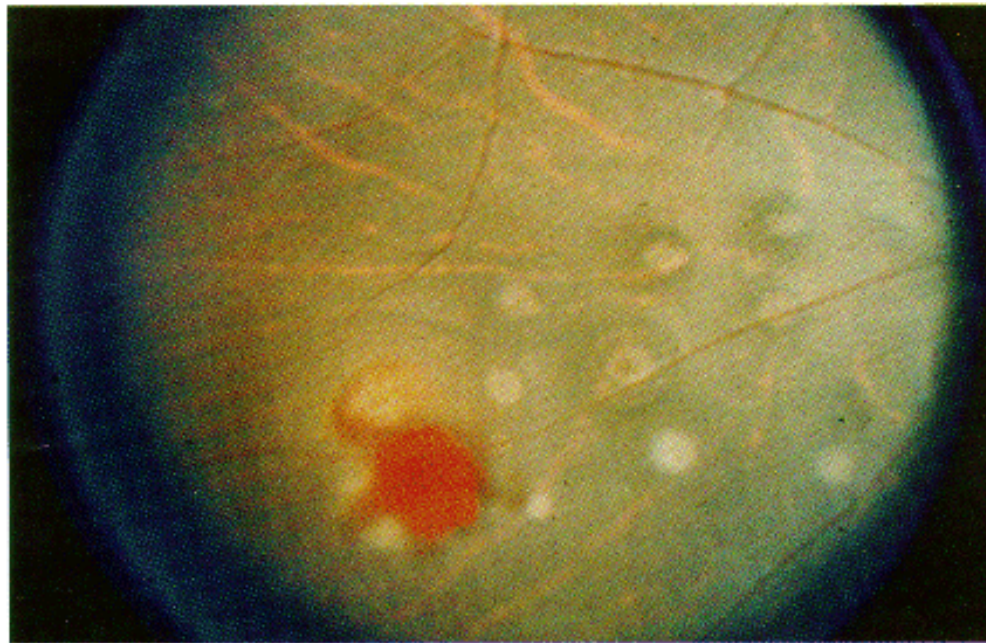


Figure 7. Multiple small laser burns with minimal hemorrhage.

Experience has demonstrated that most laser injuries go unreported for 24–48 hours by the injured person. This is a critical time for treatment of the injury

Biological Hazards – Cornea & Lens

- Inflammation injury to the cornea is caused by ultraviolet (UV) wavelengths (200-400 nm). This is the same type of injury that is caused by snow blindness
- Chronic exposure can cause cataract formation in the lens of the eye just as UV from the sun does

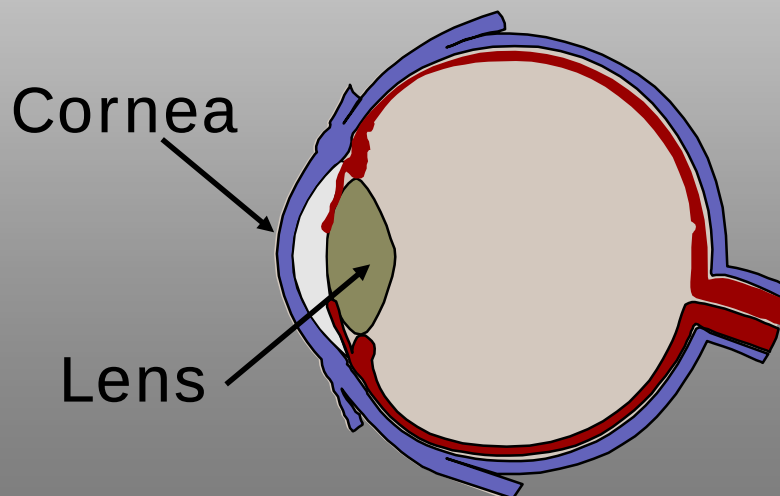

Biological Hazards - Skin

- **Ultraviolet (UV)**
 - UV can cause skin injuries comparable to sun burn
 - As with damage from the sun, there is an increased risk for developing skin cancer from UV laser exposure
- **Thermal Injuries**
 - High powered (Class 4) lasers, especially from the infrared (IR) and visible range of the spectrum, can burn the skin and even set clothes on fire

Summary of Biological Damage

Spectral region	Eye	Skin	
Ultra-violet C (180 nm to 280 nm)	Photokeratitis	Erythema (sunburn) Accelerated skin ageing	
Ultra-violet B (280 nm to 315 nm)			
Ultra-violet A (315 nm to 400 nm)	Photochemical cataract	Pigment darkening Photosensitive reactions	Skin burn
Visible (400 nm to 780 nm)	Photochemical & thermal retinal injury		
Infra-red A (780 nm to 1400 nm)	Cataract, retinal burn		
Infra-red B (1,4 µm to 3,0 µm)	Aqueous flare, cataract, corneal burn		
Infra-red C (3,0 µm to 1 mm)	Corneal burn only		

Some common unsafe practices: preventable laser accidents

- **Not** wearing protective eyewear during **alignment** procedures
- **Not** wearing protective eyewear in the laser **control area**
- **Misaligned** optics and **upwardly** directed beams
- Equipment malfunction
- Improper methods of handling high voltage
- **Available** eye protection **not used**
- Intentional exposure of unprotected personnel
- Lack of protection from non-beam hazards

Some common unsafe practices or preventable laser accidents

- **Failure** to follow (Laser) Safety Instructions
- **Bypassing** of **interlocks**, door and laser housing
- **Insertion** of **reflective** materials into beam paths
- Lack of pre-planning
- Turning on power supply accidentally
- Operating **unfamiliar** equipment
- Wearing the **wrong** eyewear

Guidelines to help prevent accidents during alignment

- No **unauthorized personnel** will be in the room or area
- Laser protective **eyewear** will be worn
- The **individual** who moves or places an optical component on an optical table is **responsible** for identifying and terminating each and every stray beam coming from that component
- To reduce accidental reflections, **watches and reflective jewellery** should be taken off before any alignment activities begin
- **Beam blocks** must be used and must be secured
- When the **beam** is directed out of the horizontal plane, it must be **clearly marked**

Guidelines to help prevent accidents during alignment (cont.)

- The **lowest** possible/practical power must be used during alignments
- Have **beam paths** that differ from the eye level when standing or sitting. Do not use paths that tempt one to bend down and look into the beam
- All laser users must **receive an introduction** to the laser area by an authorized laser user of that area

Responsibilities

The **Registered Laser User** is responsible for the safety of his employees and students and exercises his responsibility by providing training and guidelines. The RLU works with the **Laser Safety Officer** to ensure a safe working environment


We all have a **personal responsibility** to make sure that our working conditions and working habits are safe and in accordance with the guidelines

Laser Safety Regulations

- **Occupational Safety & Health Administration (OSHA)**
 - No specific laser safety regulations, but will cite safety issues under the **General Duty Clause** and will enforce the **ANSI standard for laser safety**
 - **American National Standards Institute (ANSI)**
 - **ANSI Z136.1 (current edition)**

Laser Hazard Classes

The ANSI Laser Safety standard has defined *Laser Hazard Classes*, which are based on the relative dangers associated with using these lasers

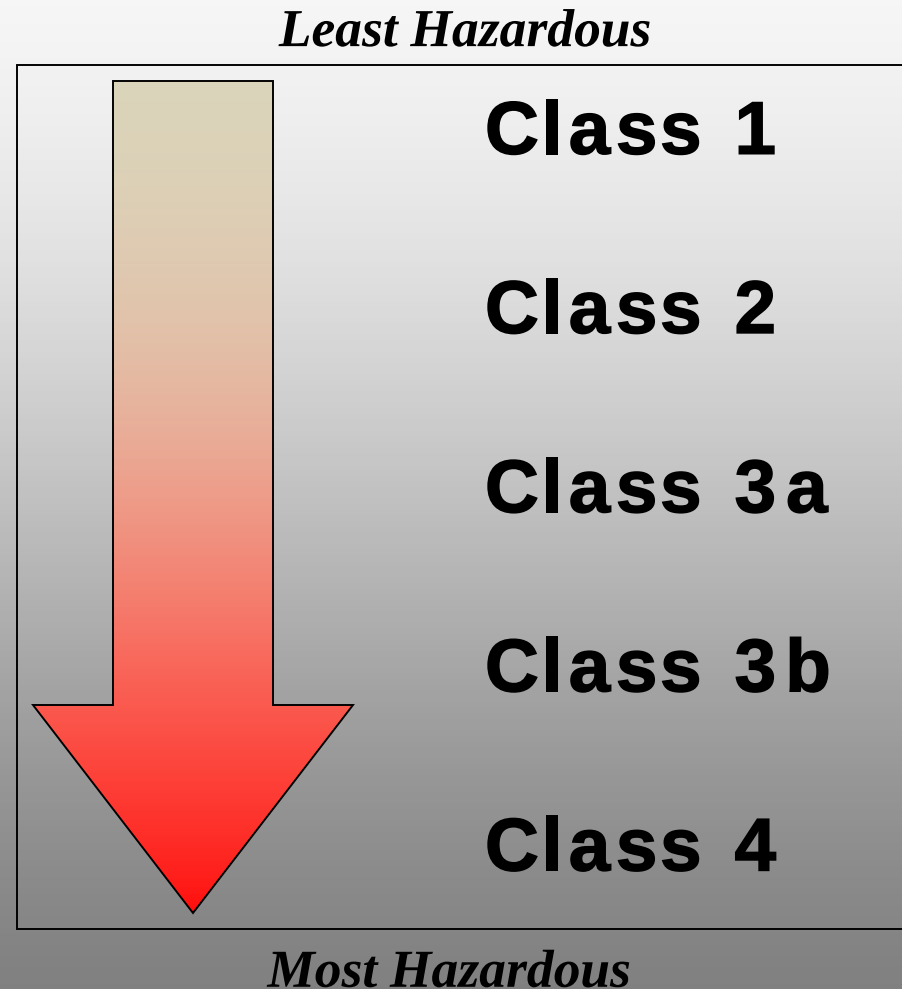

Class 1 Lasers

This class laser cannot produce a hazardous beam because it is of extremely low power,

or

The *laser system* has been rendered ***intrinsically safe*** due to the laser having been completely enclosed so that no hazardous radiation can escape and cause injury

Classes 2 Lasers

- These lasers are visible light (400-760 nm) continuous wave or pulsed lasers which can emit energy greater than the limit for Class I and 1M lasers and radiation power not above 1 mW
- This class is hazardous only if you stare directly into the beam for a long time, which would be similar to staring directly at the sun
- Because Class 2 lasers include only visible wavelengths, the *aversion reaction* will usually prevent us from permanently damaging our eyes. The *aversion reaction* refers to our tendency to look away from bright light

Class 3a Lasers

- **This class of intermediate power lasers includes any wavelength**
- **Only hazardous for intrabeam viewing.**
- **This class will not cause thermal skin burn or cause fires**

Class 3b Lasers

- **Visible and near-IR lasers are very dangerous to the eye**
- **Pulsed lasers may be included in this class**
- **This class will not cause thermal skin burns or cause fires**
- **Requires a Laser Safety Officer and written Standard Operating Procedures**

Class 4 Lasers

- **These high-powered lasers are the most hazardous of all classes**
- **Even a diffuse reflection can cause injury**
- **Visible and near-IR lasers will cause *severe* retinal injury and burn the skin. Even diffuse reflections can cause retinal injuries**
- **UV and far-IR lasers of this class can cause injury to the surface of the eye and the skin from the direct beam and specular reflections**
- **This class of laser can cause fires**
- **Requires a Laser Safety Officer and written Standard Operating Procedures**

Laser Safety Officer (LSO)

- The *Laser Safety Officer (LSO)* is someone who has authority to monitor and enforce the control of laser hazards and effect the knowledgeable evaluation and control of laser hazards
- All Class 3b and 4 lasers must have an LSO
- The *Registered Laser User* will usually be a faculty member who has primary user authority and responsibility for the laser in question. A *Laser User* must have training specific to the laser being operated, and is also responsible for its safe operation

Maximum Permissible Exposure (MPE)

- **The Maximum Permissible Exposure (MPE) is the highest level of radiation to which a person can be exposed without hazardous effects**
- **The MPE is specified in W/cm^2 for continuous wave lasers and in J/cm^2 for pulsed lasers. The value depends on wavelength, exposure duration and pulse repetition frequency**
- **Exposure to radiation levels in excess of the MPE will result in adverse biological effects, such as injury to the skin and/or eyes**

Optical Density (OD)

- **The OD (absorbance) is used in the determination of the appropriate eye protection**

OD is a logarithmic function defined by:

$$OD = \log_{10} \left[\frac{H_0}{MPE} \right]$$

Where H_0 is the anticipated worst case exposure conditions (in joules/cm² or watts/cm²) and the MPE is expressed in the same units as H_0 .

Exposure limits, Determining OD for Eyewear

- A **4 %** reflection from a 2.5 mJ laser pulse in a 2 mm beam, gives an exposure of $(10^{-4} \text{ J})/(\pi \times 0.1^2 \text{ cm}^2) = 3.2 \times 10^{-3} \text{ J/cm}^2$.
- This exceeds the threshold value of the cornea of about 10^{-7} J/cm^2 by a factor of **3.28×10^4** .
- To be adequately protected against this exposure, protective eyewear must have an optical density (OD) of **at least** $\log_{10}(3.2 \times 10^4) = 4.5$

Optical Density for Particular Lasers

Laser Type/ Power	Wavelength (μm)	OD 0.25 seconds	OD 10 seconds	OD for 600 seconds	OD for 30,000 seconds
XeCl 50 watts	0.308 ^a	---	6.2	8.0	9.7
XeFl 50 watts	0.351 ^a	---	4.8	6.6	8.3
Argon 1.0 watt	0.514	3.0	3.4	5.2	6.4
Krypton 1.0 watt	0.530	3.0	3.4	5.2	6.4
Krypton 1.0 watt	0.568	3.0	3.4	4.9	6.1
HeNe 0.005 watt	0.633	0.7	1.1	1.7	2.9
Krypton 1.0 watt	0.647	3.0	3.4	3.9	5.0
GaAs 50 mW	0.840 ^c	---	1.8	2.3	3.7
Nd:YAG 100 watt	1.064 ^a	---	4.7	5.2	5.2
Nd:YAG (Q-switch) ^b	1.064 ^a	---	4.5	5.0	5.4
Nd:YAG ^c 50 watts	1.33 ^a	---	4.4	4.9	4.9
CO ₂ 1000 watts	10.6 ^a	---	6.2	8.0	9.7

^a Repetitively pulsed at 11 Hertz, 12 ns pulses, 20mJ/pulse; ^b OD for UV and FIR beams computed using 1 mm limiting aperture which presents a "worst case scenario. All visible/NIR computation assume 7 mm limiting aperture.; ^c Nd:YAG operating at a less common 1.33 μm wavelength.; NOTE: All OD values determined using MPE criteria of ANSI Z-136.1

Nominal Hazard Zones (NHZ)

- The *Nominal Hazard Zone (NHZ)* is the location around the laser within which a person can be exposed to radiation in excess of the MPE.
- Can be determined by

$$NHZ = \frac{1}{\phi} \left[\left(\frac{4\Phi}{\pi * MPE} \right)^{\frac{1}{2}} - a \right]$$

- When Class 3B and 4 lasers are unenclosed, the Laser Safety Officer must establish a NHZ.
- People may be injured if they are within the perimeter of this zone while the laser is in operation.

Where ϕ is the divergence in radians; Φ is the radiant power or average radiant power of a pulsed laser; and a is the diameter of the beam.

Non-Beam Hazards

Non-beam hazards refer to anything other than the laser itself that can create a hazard. This type of hazard includes:

- Electrical Hazards
- Fire Hazards
- Laser Generated Air Contaminants (LGAC)
- Compressed Gases
- Chemical Hazards
- Collateral and Plasma Radiation
- Noise

Non-Beam Hazards – Electric Shock and Fire

- **Electric Shock**

Use caution when working on or near the high-voltage power supplies used for high-power Class 3 and 4 lasers; there is sufficient voltage in these power supplies to injure or kill.



- **Fire**

High powered Class 4 lasers will easily ignite flammable materials (such as paper or flammable liquids). You *must* have a fire extinguisher if you have a class 4 laser. In some circumstances, Class 3 lasers could also ignite flammable liquids.



Laser Generated Air Contaminants (LGAC)

- **The interaction of a laser beam with target material can result in the production of toxic chemicals**
- **During surgical procedures, biohazardous aerosols containing bloodborne pathogens are created**
 - **The OSHA web site provides information on biohazardous air contaminants produced during surgery**
 - **To prevent personnel from inhaling the LGAC and to prevent the release of LGAC to the environment, exhaust ventilation with special filters may be needed**
- **If you are concerned that hazardous air contaminants may be generated by your laser, contact the LSO**

Chemical Hazards

Lasers use a variety of lasing mediums, and some of these are comprised of toxic chemicals, such as dyes, solvents and hazardous gases

- Many laser dyes and solvents are toxic and carcinogenic
- A few of the hazardous gases which may be part of your lasing system include chlorine, fluorine, hydrogen chloride and hydrogen fluoride. *Please contact the RMS Chemical Hygiene Officer for assistance with the special ventilation precautions required for these gases*
- As with all hazardous chemicals, you should review the Safety Data Sheet (SDS) for the chemicals which are used in or around your laser. You should take the Chemical Hygiene course if you are using hazardous chemicals in your lab


Compressed Gases

Please take the RMS safety course on Compressed gas cylinders if you are working with laser systems that use compressed gases



Collateral & Plasma Radiation

- **Collateral radiation** refers to radiation that is not associated with the primary laser beam. This collateral radiation may be produced by power supplies, discharge lamps and plasma tubes. This radiation can be any type of EM radiation, from radio waves to X-rays
- High powered lasers can also produce **Plasma Radiation** from the interaction of the laser beam with the target material, especially when these lasers are used to weld metals. Plasma radiation may contain enough UV and/or blue light to require additional protective measures

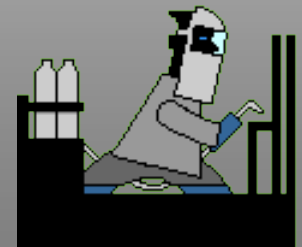

Noise

- **Noise generated by the laser system that is at 90 decibels or higher requires hearing protection**
- **If you have reason to believe that your laser is creating a hearing hazard during operation, RMS can perform noise level monitoring to determine whether or not the noise associated with your laser is at this level**

Non-Beam Hazards - Chemicals

Hazardous chemicals used as part of the lasing medium can create special problems

- Dyes and solvents used in dye lasers may be toxic and /or carcinogenic, and therefore must be handled with care. Make sure laser operators are familiar with the Safety Data Sheets for these chemicals**
- Toxic gases, such as HF and halogens commonly used for excimer lasers, will require special cabinets and air handling to prevent exposure to laser operators and release of toxic gases to the environment**

Control Measures

- There are several measures that can be taken to prevent injury from lasers. These measures include:
 - **Engineering Controls**
 - **Administrative Controls**
 - **Personnel Protective Equipment**
 - **Warning Signs and Labels**


Engineering Controls

- **Engineering controls are measures that are incorporated into the laser system and are designed to prevent injury to personnel. Engineered safety controls are preferable to PPE or Administrative controls**
- **Examples include**
 - Protective housings
 - Interlocks on Removable protective housings
 - Service access panels
 - Key control master switch (Class 3b & 4)
 - Viewing Windows, Display Screens, Collecting Optics
 - Beam path enclosures
 - Remote interlock connectors (Class 3b & 4)
 - Beam Stop or attenuator (Class 3b & 4)

Administrative Controls

Administrative controls are procedures that are designed to prevent personnel from injury. Examples of administrative controls which may be required for Class 3b & 4 lasers include:

- **Designation of Nominal Hazard Zones (NHZ)**
- **Written *Standard Operating Procedures (SOP's)* which are enforced by the Laser Safety Officer**
- **Warning signs at entrances to room**
- **Training for all personnel who will be operating the laser or in the vicinity of the laser while it is in operation**
- **Allow only authorized, trained personnel in the vicinity of the laser during operation**

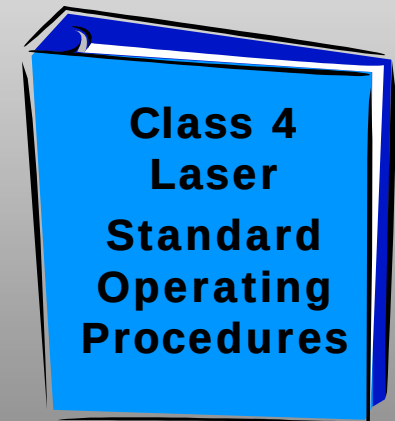


PPE for Skin

Personnel Protective Equipment (PPE) for Skin exposed to Class 3b or 4 lasers:

- **Ultraviolet lasers and laser welding/cutting operations may require that tightly woven fabrics be worn to protect arms and hands. Sun screen may also be used to provide some additional protection**
- **For lasers with wavelengths > 1400 nm, large area exposures to the skin can result in dryness and even heat stress**

PPE for Eyes

- **PPE is not required for class 2 or 3a lasers unless intentional direct viewing > 0.25 seconds is necessary**
- **Personnel Protective Equipment (PPE) for eyes exposed to Class 3b or 4 lasers is mandatory. Eyewear with side protection is best. Consider these factors when selecting eyewear:**
 - Optical Density (OD) of the eyewear
 - Laser Power and/or pulse energy
 - Laser Wavelength(s)
 - Exposure time criteria
 - Maximum Permissible Exposure (MPE)
 - Filter characteristics, such as transient bleaching

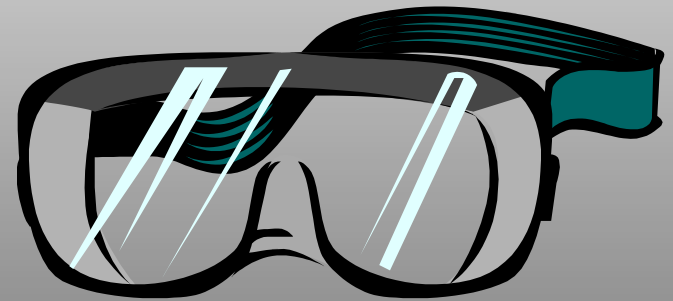

Other PPE

- **PPE may also be required to provide protection from hazardous chemicals and gases**
- **Consult with RMS if you need assistance with determining the appropriate PPE for use with your laser**

Warning Labels

Only Class 1 lasers require no labels. All other lasers must be labeled at the beam's point of origin

- **Class 2:**
"Laser Radiation – Do Not Stare into Beam."
- **Class 2M and low power 3R:**
"Laser Radiation – Do Not Stare into Beam or View Directly with Optical Instruments."
- ***Class 3R, all others-"Laser Radiation – Avoid Direct Eye Exposure."***
- **Class 3a:**
"Laser Radiation – Do not Stare into Beam or View Directly with Optical Instruments."
- **Class 3B:**
"Laser Radiation – Avoid Direct Exposure to Beam"
- **Class 4:**
"Laser Radiation – Avoid Eye or Skin Exposure to Direct or Scattered Radiation."

Warning Signs

All labs with Class 3b or 4 lasers must have appropriate signs posted at all entrances. Signs must:

- **Warn of the presence of a laser hazard in the area**
- **Indicate specific laser safety policies**
- **Indicate the relative hazard such as the Laser Class and the location of the Nominal Hazard Zone**
- **Indicate precautions needed such as PPE requirements for eyewear, etc.**

Laser Warning Signs

- **“DANGER”** indicates a very dangerous situation that could result in serious injury or death. This sign shall be used for all Class 4 lasers meeting this qualification
- **“WARNING”** shall be used on laser area warning signs for Class 3b or 4 lasers or laser systems whose output exceeds the applicable MPE
- **“CAUTION”** indicates a situation which people should be made aware. This sign should be used for Class 2 and 2M lasers
- **“NOTICE”** does *not* indicate a hazardous situation. This sign should only be used to make people aware of facility policies regarding laser safety and/or to indicate that a repair operation is in progress


“DANGER” Warning Sign

 DANGER	
	Class 4 Laser Controlled Area
	Laser eye protection required:
	OD @ nm
	Laser type:
	Average Power:
Laser Safety Officer	Phone

Safety Instructions may include:

- Eyewear Required
- Invisible laser radiation
- Controlled Entry
- Do Not Enter without express authorization
- Restricted Area


“WARNING” Warning Sign

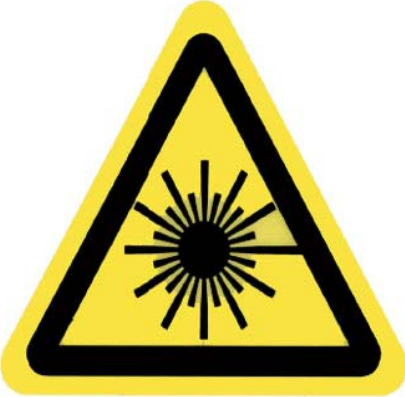	
WARNING	
	Class 3B Laser Controlled Area
	Laser eye protection required:
	OD @ nm
	Laser type:
	Average Power:
Laser Safety Officer	Phone

Safety Instructions may include:

- Eyewear Required
- Invisible laser radiation
- Knock Before Entering
- Do Not Enter When Light is On
- Restricted Area

“CAUTION” Warning Sign

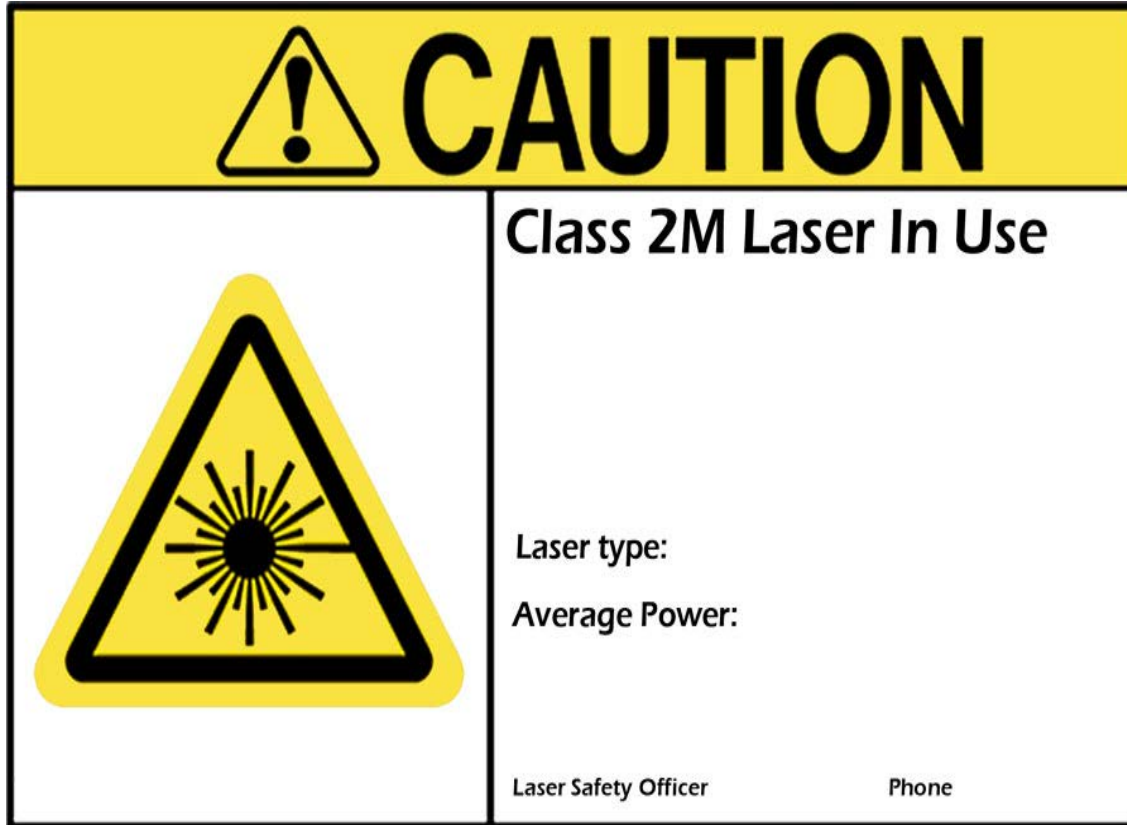


Safety Instructions may include:

- Visible laser radiation
- Follow applicable procedures

“NOTICE” Sign for Laser Repair

NOTICE

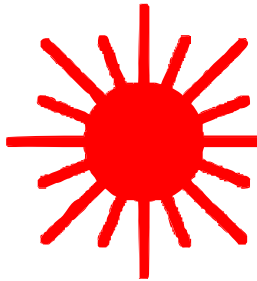

Safety Instructions go here
(such as “Laser Repair in
Progress”)

Type of Laser, emitted
wavelength, pulse duration,
and maximum output go here

Laser Class and system go here

Safety Instructions may
include:

- Eyewear may be required
- Invisible or visible laser radiation may be present
- Follow applicable instructions

Additional Warnings for 3b & 4 Lasers

- **The Nominal Hazard Zone is the area associated with a laser or laser system within which the MPE can be exceeded. It may be small or it may include the entire laser enclosure or laboratory**
- **The (NHZ) must be marked so that the boundary of the NHZ is clearly defined**
- **An audible alarm, warning light or a verbal warning or “countdown” is required before activation**
- **A visible warning light should flash when the laser is in operation and the light should be readily visible through protective eyewear**

Leading Causes of Laser Accidents

- **Unanticipated eye exposure during alignment**
- **Available eye protection not used**
- **Equipment malfunction**
- **Improper methods for handling high voltage
(This type of injury has resulted in death.)**
- **Inadequate training**
- **Failure to follow SOP**
- **Failure to provide non-beam hazard protection.**
- **Equipment improperly restored following service**
- **Incorrect eyewear selection and/or eyewear failure**

For More Information

- **OSHA Technical Manual – Laser Safety chapter is especially useful**
- **The ANSI Z136.1 Laser Safety Standard is the best reference to consult for laser safety information.**
 - One copy is available for viewing within the RMS administrative offices. (This copy will not be loaned out)
 - You can also purchase a copy of the standard through the Laser Institute of America web site (<http://www.laserinstitute.org>)
- **Call the Laser Safety Officer at 5-4226 if you have additional questions about laser safety**

Contact and Emergency Phone Numbers

- ***Laboratory contact numbers must be posted inside the lab and outside on, or near the door***
 - UNLV RMS 5-4226
 - UNLV Radiation Safety 5-4419
 - UNLV Public Safety 911

Examples of laser accidents

Ancillary Slides, not needed for presentation – but interesting

413 Picosecond pulses cause bleeding/latent viewing distortion

Description:

New frequency doubler didn't have AR coatings as requested. As person left room, beam hit eye corner and penetrated the sclera and caused intraocular bleeding. Subsided at 2 wks and eye normal at 2 months. Person still complains at 8 *YRS* of floaters and vision that looks "like looking through a dirty window."

Type: FD Nd:YAG
Wavelength: 1064 nm
Class: IV
Exposure Time: 60 ps

Divergence: -----
Energy/Power: MW/cm²+
Pulse Rate: 1 KHz

165 Reflected beam caused vision loss

Description:

Professor from China removed eyewear to "see better" while doing an experiment with a crystal. Exposure produced retinal burn and permanent vision loss. He described seeing a white flash, central purple spot surrounded by yellow halo. No pain reported.

223 Retinal burn from beam off rear laser mirror

Description:

Student *WITH EYEWEAR ON* (and witness to verify) received exposure from the rear mirror of a "Continuum" YAG laser. The student was wearing Glendale Broadband (OD 4.0) eyewear; ANSI standard requires OD=6.0. Retinal burn resulted with permanent damage.

Type: Nd:YAG

Wavelength: 532 nm

Class:-

Exposure Time: 7 ns

Divergence:-

Energy/Power: 0.18/0.40

Pulse Rate: 5 KHz

356 Blurred vision from reflected exposure

Description:

Student received reflected beam from plastic tool box lid from Ti-Sapphire laser. No eye protection worn. Student reported blurred vision and seeing black spots. He was installing a laser transport tube (beam safety tube). The student had not received laser safety training. At 1 month student still had blurry vision.

Type: Ti-Sapphire

Wavelength: 800 nm

Class: IV

Exposure Time: 120 fs

Divergence:-

Energy/Power: 15 mJ

Pulse Rate: 10 KHz

312 Off-axis beam causes macular burn in left eye

Description:

Scientist bumped mirror mount in a complex optical array - causing a stray beam to go off-axis. When leaning over the table, he was struck in left eye by beam off lower array mirror. Exam confirmed macular lesion which he states disrupts vision. No eyewear worn and safety knowledge was limited.

Type: Ti-Sapphire

Wavelength: 800 nm

Class: IV

Exposure Time: 50 ns

Divergence:-

Energy/Power: 6 mJ

Pulse Rate: 3.3K KHz

307 Backscatter from mirror causes haemorrhage and oveal blindspot

Description:

A 26 year old male student aligning optics in a university chemistry research lab using a "chirped pulse" Titanium-Sapphire laser operating at 815 nm with 1.2 mJ pulse energy at 1 KHz. Each pulse was about 200 picoseconds.

The laser beam backscattered off REAR SIDE of mirror (about 1% of total) causing a foveal retinal lesion with haemorrhage and blind spot in central vision.

A retinal eye exam was done and confirmed the laser damage.

The available laser protective eyewear was not worn.

283 Photophobia in right eye after beam misalignment

Description:

Received "flash" into eye during alignment where he looked back along the beam path to view reflection off laser face plate. Result caused photophobia with burning sensation. No retinal burns detected. Patient used sunglasses for photophobia.

Type: HeNe

Wavelength: 633 nm

Class:-

Exposure Time: ~0.25 sec

Divergence:-

Energy/Power: 6 mW

Pulse Rate:-

Los Alamos Laser Accident

Description:

A postdoctoral employee received an eye exposure to spectral radiation from an 800 nm Class 4 laser beam. The extremely short pulse (100 fs) caused a 100-micron-diameter burn in the employee's retina. The accident occurred shortly after a mirror was removed from its mount and replaced with a corner cube during a realignment procedure. Although the beam had been blocked during several previous steps in the alignment, it was not blocked in this case. The employee was exposed to laser radiation from the corner cube mount when he leaned down to check the height of the mount. Neither of the two employees performing the alignment was wearing the appropriate laser eye protection. The system had two modes of operation: 10 Hz and 1,000 Hz. In addition, the researcher forgot that the part of the 800 nm beam he could see represented only 1-2% of the beam.

Acknowledgement / References

- This presentation uses slides and information prepared by:
 - http://www.safety.vanderbilt.edu/training/laser/laser_safety.pps
 - http://lf.tnw.utwente.nl/safety/Introduction_Laser_Safety.ppt
 - <http://web.princeton.edu/sites/ehs/laserguide/sec6.htm>
 - <http://en.wikipedia.org/wiki/Laser>
- Laser incidents taken from laser accident database of Rockwell Laser Industries, Inc.
(<http://www.rli.com/resources/accident.asp>)
- Certain descriptions and numbers are taken from the international standard: IEC 60825-1 Edition 1.2.